

S80-2-21-0030**Background:**

A knocking noise may be heard when driving at low speeds on uneven surfaces or when turning. The noise is caused by the rear sub-frame bushings moving in the sub-frame. Knocking can be felt in the floor under the driver's feet.

Install an O-ring between the sub-frame and the bodywork on the rear bushings on both the left and right hand sides as a service solution.

Affected cars:

Car model	Factory code	Chassis number
S80	VTM=1	000580-137346

Materials:

Description	Number	P/N
O-ring	2	8638585
Screw	2	981062

Sub frame bushing, knocking noise