

283: Control system, ignition, D5244T18

XC90, 2011, D5244T18, TF-80SC AWD

27/4/2022




PRINT

283: Control system, ignition, D5244T18**Position sensor
camshaft, replacing**

Note! As the illustrations in this service information are used for different model years and / or models, some variation may occur. However, the essential information in the illustrations is always correct.


Removal**Removing the upper
engine cover**

Pull the front edge straight up and then pull forward.

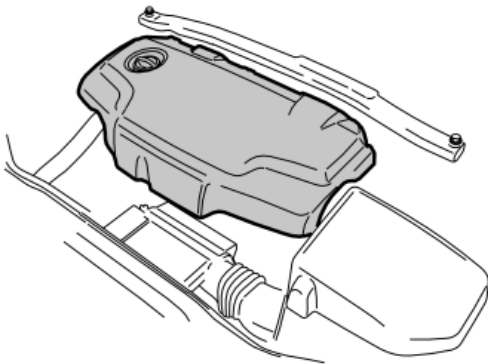**Removing the rear
engine cover**


Remove:

- the 4 M6 nuts
- the engine cover.

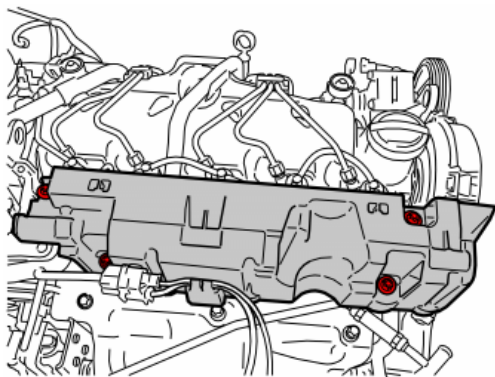

Remove:

- the connector from the camshaft position sensor

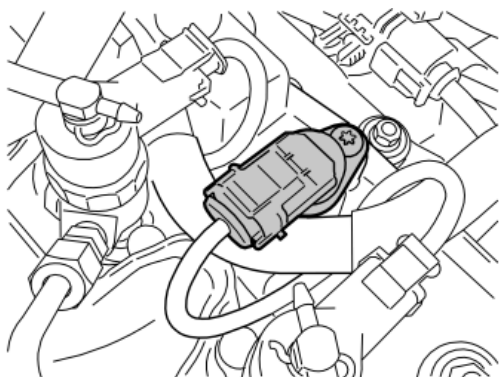

- the 1 M6 torx screw
- the camshaft position sensor.

Finishing

Installing the upper and lower engine cover, components

Install:

- the camshaft position sensor
- 1 M6 torx screw. Tighten.
- the connector of the camshaft position sensor
- the rear engine cover
- the upper engine cover.

PRINT

27/4/2022